

## **Customer Release Notes**

## ExtremeCloud IQ Controller

Firmware Version V.10.01.01.0032 April 5, 2022

#### **INTRODUCTION:**

The ExtremeCloud IQ Controller, is a next generation orchestration application offering all the mobility services required for modern unified access deployments. The ExtremeCloud IQ Controller includes comprehensive critical network services for wireless and wired connectivity, wireless device secure onboarding, distributed and centralized data paths, role-based access control through the Application Layer (Layer 7), integrated location services, and IoT device onboarding through a single platform. Built on field proven architectures with the latest technology, the embedded operating system supports containerization of applications enabling future expansion of value-added applications for the unified access edge.

The E3120 is a large application appliance meeting the needs of high-density and mission critical deployments with support for up to 20,000 APs/Defenders, 2000 switches, and 100,000 mobility sessions in high-availability mode. An optional redundant power supply is available for ordering separately.

The E2120 is an application appliance meeting the needs of medium sized high-density and mission critical deployments with support for up to 4,000 APs/Defenders, 800 switches and 32,000 mobility sessions in high-availability mode. An optional redundant power supply is available for ordering separately.

The E2122 is an application appliance meeting the needs of medium sized high-density and mission critical deployments with support for up to 4,000 APs/Defenders, 800 switches and 32,000 mobility sessions in high-availability mode. An optional redundant power supply is available for ordering separately.

The E1120 is an entry to mid-level platform expandable to 250 APs/Defenders, 100 switches, and 4,000 mobility sessions in high-availability mode.

The VE6120 is an elastic virtual appliance that supports up to 1,000 APs/Defenders, up to 400 switches and 16,000 mobility sessions in high-availability mode depending on the hosting hardware.

The VE6120 VE6120H and VE6120K offer elastic capacities to cover the full range of offering as VMWare/MS Hyper-V/Linux KVM, ranging from VE6120/VE6120H/VE6120K-Small to VE6120/VE6120H/VE6120K-Large.

The VE6125/VE6125K XL are virtual appliances that supports up to 4,000 APs/Defenders, up to 400 switches and 32,000 mobility sessions in high-availability mode, depending on the hosting hardware.

The ExtremeCloud IQ Controller offers the ability to expand capacity to meet any growing business needs. The hardware and virtual packages are available for purchase using a traditional CAPEX model.

ExtremeCloud IQ Controller leverages the same subscriptions as ExtremeCloud IQ normalizing capacity management to same unified SKUs for cloud or on-premise management. ExtremeCloud IQ controller capacity license enforced as a quantity of Navigator (XIQ-NAV-S-C-EW/PWP) or Pilot (XIQ-PIL-S-C-EW/PWP) subscriptions. Contact your sales representative for any questions related to migrating from Extreme Campus Controller (v5).

Enhancements in 10.01.01.0032		
Introducing ExtremeCloud IQ Controller, the next generation of premium, on-premise wireless management.	XCC-2066	
ExtremeCloud IQ Controller leverages the same subscriptions as ExtremeCloud IQ, normalizing capacity management to same unified SKUs. ExtremeCloud IQ controller capacity license enforced as a quantity of Navigator (XIQ-NAV-S-C-EW/PWP) or Pilot (XIQ-PIL-S-C-EW/PWP) subscriptions.  Please contact your sales representative for any questions related to migrating from Extreme Campus Controller (v5).	XCC-1789	
Integration with ExtremeCloud IQ Redirector function to automate onboarding of ExtremeCloud IQ Controllers into ExtremeCloud IQ accounts (VIQ).  Note: Controllers upgrading from V5 that were previously registered in ExtremeCloud IQ, need to be removed and re-added in order for the automated onboarding workflow to complete.	XCC-2279	
Enhanced maximum capacity of E3120 hardware controller to 10,000 managed devices (per controller) for a maximum paired capacity of 20,000 managed devices.	XCC-14	
Improved option to control restrictions of Layer 2 network broadcasts to only essential services (ARP, DHCP) at a topology (VLAN) level. Topology level enforcement has precedence over end-user policy definitions.	XCC-2300	
Adjusted SmartRF protocol to align channel selection with Preferred Scan Channels (PSC) for radio management in 6Ghz band.	XCC-1636	
Introduced new Diagnostics dashboard, under Tools menu, featuring System Health, Network Health, and AP SmartPoll widgets to better expose system operation state.	XCC-2191	
Introduced support for transparent bridging in Mesh connections for WiFi 6 (802.11ax) or newer APs. Transparent Mesh extension of arbitrary VLAN segments over a wireless Mesh connection.	XCC-1958	
Enhanced AP SmartPoll widget to support in-column sorting to improve assessment flexibility in determining minimum and maximum values.	XCC-2190	
Deprecated support for integration with ExtremeLocation, which has reached End-of-Sale as of August 2020.	XCC-2192	
Updated OS distribution and kernel upgrade to newer revision and to pick up additional security enhancements.	XCC-2193	

Changes in 10.01.01.0032	I.D
Corrected the issue where a long URL was created erroneously after editing floor plans.	XCC-2265
Corrected issue that could affect synchronization of configuration updates between two controllers in a High Availability Pair.	XCC-2277
Adjusted maximum size of COA shared secret to allow 64 characters.	XCC-2336

Changes in 10.01.01.0032	I.D
Corrected issue with definition of ACS settings for RF Management policy of AP3900 series devices.	XCC-2318
Corrected issue with processing of topology change notifications that could affect updates to policy enforcement for dynamic topology assignment.	XCC-2315

Extreme Networks recommends that you thoroughly review this document prior to installing or upgrading this product.

For the latest firmware versions, visit the download site at: <u>www.extremenetworks.com/support/</u>

## **FIRMWARE SPECIFICATION:**

Status	Version No.	Туре	Release Date
Current Version	V.10.01.01.0032	Feature Release	April 5, 2022

## SUPPORTED APPLIANCES, ACCESS POINTS AND SWITCHES:

Product Name	Image
ExtremeCloud IQ Controller VE6120 VMware Min Supported ESXi version 5.1 or later, (tested 7.0)	XIQC-10.01.01.0032-1.dle
ExtremeCloud IQ Controller VE6120H (Windows server 2016 or later)	XIQC-10.01.01.0032-1.spe
ExtremeCloud IQ Controller VE6120K Linux KVM	XIQC-10.01.01.0032-1.dve
ExtremeCloud IQ Controller VE6125 Min Supported ESXi version 5.5 or later, (tested 7.0)	XIQC-10.01.01.0032-1.rse
ExtremeCloud IQ Controller VE6125K Linux KVM	XIQC-10.01.01.0032-1.mfe
ExtremeCloud IQ Controller E1120	XIQC-10.01.01.0032-1.sme
ExtremeCloud IQ Controller E2120	XIQC-10.01.01.0032-1.jse
ExtremeCloud IQ Controller E2122	XIQC-10.01.01.0032-1.wze
ExtremeCloud IQ Controller E3120	XIQC-10.01.01.0032-1.ose
SA201	AP391x-10.51.21.0002.img
AP302W-CAN AP302W-FCC AP302W-IL AP302W-WR	AP302W-LEAN-10.0.0.0-055R.img
AP305C-CAN AP305C-FCC AP305C-IL AP305C-WR AP305CX-CAN AP305CX-FCC	AP3xxC-LEAN-10.0.0.0-055R.img

Product Name	Image
AP305CX-IL AP305CX-WR	
AP310e-1-WR AP310e-CAN AP310e-FCC AP310e-IL AP310e-WR AP310i-1-WR AP310i-CAN AP310i-FCC AP310i-IL AP310i-WR	AP3xx-LEAN-10.0.0.0-055R.img
AP360e-CAN AP360e-FCC AP360e-IL AP360e-WR AP360i-CAN AP360i-FCC AP360i-IL AP360i-WR	AP3xx-LEAN-10.0.0.0-055R.img
AP3912i-FCC AP3912i-ROW	AP391x-10.51.21.0002.img
AP3915e-FCC AP3915e-ROW AP3915i-FCC AP3915i-ROW	AP391x-10.51.21.0002.img
AP3916ic-FCC AP3916ic-ROW	AP391x-10.51.21.0002.img
AP3916-camera	AP3916IC-V1-0-14-1.dlf
AP3917e-FCC AP3917e-ROW AP3917i-FCC AP3917i-ROW AP3917k-FCC AP3917k-ROW	AP391x-10.51.21.0002.img
AP3935e-FCC AP3935e-ROW AP3935i-FCC AP3935i-IL AP3935i-ROW	AP3935-10.51.21.0002.img
AP3965e-FCC AP3965e-ROW AP3965i-FCC AP3965i-ROW	AP3935-10.51.21.0002.img
AP4000-WW	AP4000x-LEAN-10.0.0.0-055R.img
AP410C-CAN AP410C-FCC	AP4xxC-LEAN-10.0.0.0-055R.img

Product Name	Image
AP410C-IL AP410C-WR	
AP410e-CAN AP410e-FCC AP410e-IL AP410e-WR AP410i-1-FCC AP410i-1-WR AP410i-CAN AP410i-FCC AP410i-IL AP410i-WR	AP4xx-LEAN-10.0.0.0-055R.img
AP460C-CAN AP460C-FCC AP460C-IL AP460C-WR AP460S12C-CAN AP460S12C-FCC AP460S12C-IL AP460S12C-WR AP460S6C-CAN AP460S6C-CAN AP460S6C-FCC AP460S6C-FCC AP460S6C-IL AP460S6C-WR	AP4xxC-LEAN-10.0.0.0-055R.img
AP460e-CAN AP460e-FCC AP460e-IL AP460e-WR AP460i-CAN AP460i-FCC AP460i-IL AP460i-WR	AP4xx-LEAN-10.0.0.0-055R.img
AP505i-FCC AP505i-WR	AP5xx-LEAN-10.0.0.0-055R.img
AP510e-FCC AP510e-WR AP510i-1-FCC AP510i-1-WR AP510i-FCC AP510i-WR	AP5xx-LEAN-10.0.0.0-055R.img
AP560h-FCC AP560h-WR AP560i-FCC AP560i-WR	AP5xx-LEAN-10.0.0.0-055R.img
Switches	
210-12p-10GE2 210-24p-10GE2 210-48p-10GE2 210-12p-10GE2 POE	210-series_V1.02.05.0013.stk fp-connector-3.3.0.4.pyz (cloud connector)

Product Name	Image
210-24p-10GE2 POE 210-48p-10GE2 POE	
220-12p-10GE2 220-24p-10GE2 220-48p-10GE2 220-12p-10GE2 POE 220-24p-10GE2 POE 220-48p-10GE2 POE	220-series_V1.02.05.0013.stk fp-connector-3.3.0.4.pyz (cloud connector)
X435-24P/T-4S	summitlite_arm-30.7.1.1.xos summitlite_arm-30.5.0.259-cloud_connector- 3.4.2.6.xmod
X440G2-12t-10G4 X440G2-24t-10G4 X440G2-48t-10G4 X440G2-12t-10G4 POE X440G2-24t-10G4 POE X440G2-48t-10G4 POE	summitX-30.2.1.8-patch2-5.xos summitX-30.2.1.8-cloud_connector-3.4.1.8.xmod (cloud connector)
X465_24W X465_48T X465_48P X465_48W X465_24MU X465_24MU_24W	onie-30.2.1.8-patch2-5-vpex_controlling_bridge.lst onie-30.2.1.8-cloud_connector-3.4.1.20.xmod
X620-16x	summitX-30.2.1.8-patch2-5.xos summitX-30.2.1.8-cloud_connector-3.4.1.8.xmod (cloud connector)

## **NETWORK MANAGEMENT SOFTWARE SUPPORT**

Network Management	Version
ExtremeControl™	22.3 or higher
ExtremeAnalytics™	22.3 or higher
ExtremeCloud™ A3	4.0
ExtremeCloud™ IQ-Site Engine	22.3 or higher

Air Defense and Location	Version
ExtremeAirDefense™	10.5
ExtremeGuest	Version
ExtremeGuest™	6.0.1.0-001

#### Note:

Platform and AP Configuration functions are not supported by ExtremeManagement™. ExtremeCloud™ IQ Site Engine v22.3 or greater is required.

04/05/2022 P/N: 9037458-00

## **INSTALLATION INFORMATION:**

Appliance Installations		
E1120	Extreme Campus Controller E1120 Installation Guide	
E2120	Extreme Campus Controller E2120 Installation Guide	
E2122	Extreme Campus Controller E2122 Installation Guide	
E3120	Extreme Campus Controller E3120 Installation Guide	
VE6120/VE6125	Extreme Campus Controller VE6120/VE6125 Installation Guide	
VE6120H	Extreme Campus Controller VE6120H Installation Guide	
VE6120K/VE6125K	Extreme Campus Controller VE6120K/VE6125K Installation Guide	

## **Known Restrictions and Limitations:**

Known Restriction or Limitation	I.D
Certain wireless clients (such as Qualcomm Killer Wireless 1535 and Intel 7265D/8260/8265) have been known to not complete the 4-way handshake in order to fulfill the association process in networks that have both PMF/MFP (802.11w) and Fast-Transition (802.11r [FT]) enabled.  The currently recommended workaround is to not enable PMF/MFP configuration on a service that is also using 802.11r. Such clients have been demonstrated to work correctly on services with just 802.11r (FT) enabled.	nse0003416
For systems previously onboarded into ExtremeCloud IQ account for visibility, following upgrade from previous release (V5) to ExtremeCloud IQ Controller (v10) the controller entry in ExtremeCloud IQ needs to be removed and re-declared, so as to facilitate re-synchronization of the controller with the Account.	XCC-2463
Before installing a new ExtremeCloud IQ Controller license, you must configure Network Time Protocol (NTP) Server settings. Licensing management is dependent on accurate NTP configuration. Configure NTP via the ExtremeCloud IQ Controller initial Configuration Wizard, or go to Admin > System > Network Time to configure and verify the NTP settings.	XCC-2353
For ExtremeCloud IQ Controller configured for authentication of administrators over RADIUS server, the GUI responsiveness may be slow, possibly over 30 seconds if the target server(s) are unavailable or unreachable at login time. If the outage is extensive, the system will eventually timeout to validate against local credentials when provisioned.	XCC-2350
A reboot of the peer ExtremeCloud IQ Controller is required when Availability is configured for the first time to ensure synchronization of the configuration of ONBOARD attributes, such as device groups. This issue will be addressed in a future release.	XCC-2349
ExtremeCloud IQ-Site Engine 22.3.10 is the minimum required revision for representation of ExtremeCloud IQ Controller 10.01.01 or later revisions. Extreme Management Center (8.5.x or later) does NOT recognize a controller running ExtremeCloud IQ Controller 10.01.01 or later.	XCC-2348

Known Restriction or Limitation	I.D
To improve stability of mesh when SmartRF is used with a mesh root AP:  * Use fixed channel width.  * Set SmartRF sensitivity to "Low" to decrease the time that the AP will abandon the channel for scanning.	XCC-1684
When an infrastructure WLAN (used for connecting client bridge APs) has Quiet IE enable, the client bridge link becomes unstable. It is a best practice to disable Quiet IE when a WLAN is used for a client bridge connection.	XCC-1570
The switch primary/backup availability is not supported on the EXOS switches running the 3.4.1.8 Cloud Connector. This affects the deployments where two appliances are configured in an Availability Pair. If the primary appliance is going down, then the EXOS switches will not send statistics to the backup appliance and will be marked in red "Critical" state. When the primary appliance is coming up again, the switches will resume sending statistics information to the primary appliance and the state of the switch will be marked with a green "Running" state.	ECA-455
Allow UTF-8 characters in JSON payload for all Rest API so non-ASCII / Unicode characters are accepted in Rest API requests to comply with current Rest API standards.	ECA-321
MAC-based authentication and WPA3-Compatibility (SAE or WPA2-PSK) and PMF "Required" may not work. This issue will be addressed in a future release.	ECA-1961
For High-Availability installations, on systems configured with RADIUS Accounting or Smart RF enabled, clients (end-systems) may experience a momentary disconnect during the upgrade process (maintenance window).  Users immediately reconnect to the available infrastructure, so impact is negligible. For smoother session availability with fast-failover during a failover event, it is recommended to not run these options. This issue is being investigated and will be addressed in a future release.	ECA-1264
Upgrade failure will occur when using special characters (escape back slash) in topology.	ECA-466
In SmartRF mode, the AP510 power may temporarily drop to 0dBm and returns to 4dBm.	ECA-469
With on-air-busy channel conditions, it is possible for the ACS not to produce the expected results. In this instance, perform manual channel selection.	ECA-528
Widgets do not show tooltips for lower and upper values. This issue will be addressed in a future release.	ECA-567
Firmware for ExtremeWireless AP3900 series access points does not currently support Smart RF. No Smart RF data is displayed.	ECA-1484
Several old Intel clients (i.e. Intel dual band Wireless AC – 7260) if they are using old drivers are NOT seeing BSSID / SSID advertising 11x capability. This is a client issue (forward compatibility). Other older clients may have this issue. See: [https://www.intel.com/content/www/us/en/support/articles/000054799/network-and-i-o/wireless-networking.html http://example.com] See KB: [https://gtacknowledge.extremenetworks.com/articles/Solution/AP510-Unable-to-see-the-SSID-on-my-laptop http://example.com] NB – The client driver update must be done from Intel\drivers' site because the Windows update reports that the client is running the latest driver.	Info

Known Restriction or Limitation	I.D
radios must be configured on a/n/ac (disable ax) until all clients will upgrade to the latest driver.	
Default router/gateway should be configured with a next-hop associated with one of the physical interfaces. Pointing the default route to the Admin interface will lead to issues because access points will not get the correct services from the data plane. We recommend setting the default route via data ports, and if necessary, configuring static routes on the Admin port for administration level access.	Info
For AP deployments in remote locations where access points and controllers may need to be discovered and connected over firewalls, a best practice is to leverage DNS or DHCP Option 60/43 methods for zero-touch-provisioning discovery. These methods provide direct connectivity to the defined IP address. DHCP Option 78, which refers to the controller as a Service Location Protocol – Directory Agent (SLP- DA), requires the exchange of SLP protocol between the AP and the appliance at the core, necessitating that UDP 427 be allowed by any firewall in the path. For such installations, discovery over DHCP Option 78 assist is not recommended.  When using SLP, for an AP to establish connection with a controller, it must first exchange SLP Directory Agent registration before IPSEC establishment with the eventual controller. That means that SLP UDP 427 must be open along the path. Further issues can occur if Network Address Translation (NAT) is involved. While this method is popular and widely deployed within a homogenous campus, it may result in inadvertent complications for remote connections. Therefore, it should not be used in favor of an alternate method (DHCP 60/43, DNS, or static override).	Info
When configuring system for NTP time assignment, ensure that the NTP server is properly configured. Incorrect time settings (like timestamps far in the future) may adversely affect system operation, such as certificate expiration that may trigger failures in device registration or system instability.	Info nse0003696
Appliances in a High-Availability pair must be of the same model and at the same exact software revision (and time synched) for configuration synchronization to propagate to the peer. During the upgrade process of a High-Availability pair, any configuration changes made while only one appliance has been upgraded (and therefore resulting in a version mismatch) will not be propagated until the peer is correspondingly upgraded to the same revision. We recommend that you NOT perform configuration changes to one of the members of a High-Availability pair while the peer has a different software revision.	Info nse0005086
For High-Availability configurations, during upgrade phases or configuration restore operations, wait until the availability link is established and synchronized before attempting to make any new configuration changes. The Availability status will only re-establish to Synched status when both appliances are running the exact same firmware revision.  During upgrade periods, the Availability link will only re-establish when both the appliance status of availability link and synchronization status can be found. Go to:  . "Network Health" widget on the Dashboard, or . Administration -> System -> Availability	Info ECA-776
Recommendation settings for setup of redundant RADIUS server authentication:  · Response Window to 5s [Default: 20s]  · Revival Interval to 10s [Default: 60s]	Info ECA-875

## **SUPPORTED WEB BROWSERS**

For ExtremeCloud IQ Controller management GUI, the following Web browsers were tested for interoperability:

- Firefox 81.0
- Google Chrome 86.0

Note: Microsoft IE browser is not supported for UI management.

The Wireless Clients (Captive Portal, AAA):

Browsers	Version	os
Chrome	75.0.37770.142	Windows 7 Windows 10
Microsoft IE	11	Windows 7 Windows 8.1 Windows 10
Microsoft Edge	42.17134	Windows 10
Firefox	68.0	Windows 10
Safari	Preinstalled with iOS 12.2	iOS 12.2
Safari	Preinstalled with iOS 9.3.5	iOS 9.3.5

## **PORT LIST**

The following list of ports may need to remain open so that the Appliances and APs will function properly on a network that includes protection equipment like a firewall.

#### **ExtremeCloud IQ Controller TCP/UDP Port Assignment Reference**

Comp. Source	Comp. Dest	Protocol (TCP/UDP)	Src Port	Dest Port	Service	Remark	Open Firewall Req'd
		Ports t	for AP/A <sub>l</sub>	ppliance	Communicatio	n	
Appliance	Access Point	UDP	Any	13910	WASSP	Management and Data Tunnel between AP and Appliance	Yes
Access Point	Appliance	UDP	Any	13910	WASSP	Management and Data Tunnel between AP and Appliance	Yes
Appliance	Access Point	UDP	4500	Any	Secured WASSP	Management Tunnel between AP and Appliance	Optional

04/05/2022 P/N: 9037458-00

Comp. Source	Comp. Dest	Protocol (TCP/UDP)	Src Port	Dest Port	Service	Remark	Open Firewall Req'd
Access Point	Appliance	UDP	Any	4500	Secured WASSP	Management Tunnel between AP and Appliance	Optional
Access Point	Appliance	UDP	Any	13907	WASSP	AP Registration to Appliance	Yes
Access Point	Appliance	UDP	Any	67	DHCP Server	If Appliance is DHCP Server for AP	Optional
Access Point	Appliance	UDP	Any	68	DHCP Server	If Appliance is DHCP Server for AP	Optional
Access Point	Appliance	UDP	Any	427	SLP	AP Registration to Appliance	Optional
Appliance	Access Point	TCP/UDP	Any	69	TFTP	AP image transfer	Yes
Access Point	Appliance	TCP/UDP	Any	69	TFTP	AP image transfer	Yes
Appliance	Access Point	TCP/UDP	Any	22	SCP	AP traces	Yes
Any	Access Point	TCP	Any	2002, 2003	RCAPD	AP Real Capture (if enabled)	Optional
Any	Access Point	TCP/UDP	Any	22	SSH	Remote AP login (if enabled)	Optional
Any	Access Point	TCP/UDP	Any	445	Microsoft CIFS	LDAP support	Optional
Any	Access Point	TCP/UDP	Any	137, 138, 139	NetBIOS	LDAP support	Optional
	Ports for Appliance Management						
Any	Appliance	TCP/UDP	Any	22	SSH	Appliance CLI access	Yes
Any	Appliance	TCP/UDP	Any	5825	HTTPS	Appliance GUI access	Yes
Any	Appliance	TCP/UDP	Any	161	SNMP	Appliance SNMP access	Yes
Any	Appliance	TCP/UDP	Any	162	SNMP Trap	Appliance SNMP access	Yes

Comp. Source	Comp. Dest	Protocol (TCP/UDP)	Src Port	Dest Port	Service	Remark	Open Firewall Req'd
Any	Appliance	TCP	Any	80	HTTP	Appliance SNMP access ICP Self Registration	Yes
Any	Appliance	TCP	Any	443	HTTPS	ICP Self Registration	Yes
Any	Appliance	UDP	500	500	IKE	IKE phase 1	Yes
Any	Appliance	TCP/UDP	Any	69	TFTP	TFTP support	Yes
Any	Appliance	UDP	Any	4500	IPSec	IPSec NAT traversal	Yes
Any	Appliance	UDP	Any	13907	Discovery	Used by Discovery	Yes
Any	Appliance	UDP	Any	13910	WASSP	Used by L3 WASSP	Yes
		Ports for Int	er Contr	oller Mol	oility¹ and Avai	lability	
Appliance	Appliance	UDP	Any	13911	WASSP	Mobility and Availability Tunnel	Yes
Appliance	Appliance	TCP	Any	427	SLP	SLP Directory	Yes
Appliance	Appliance	TCP	Any	20506	Langley	Remote Langley Secure	Yes
Appliance	Appliance	TCP	Any	60606	Mobility	VN MGR	Yes
Appliance	Appliance	TCP	Any	123	NTP	Availability time sync	Yes
Appliance	DHCP Server	UDP	Any	67	SLP	Asking DHCP Server for SLP DA	Yes
DHCP Server	Appliance	UDP	Any	68	SLP	RespoECA from DHCP Server for SLP DA request	Yes
	Core Back-End Communication						
Appliance	DNS Server	UDP	Any	53	DNS	If using DNS	Optional
Appliance	Syslog Server	UDP	Any	514	Syslog	If Appliance logs to external syslog server	Optional
Appliance	RADIUS Server	UDP	Any	1812	RADIUS Authentication and Authorization	If using RADIUS AAA	Optional

<sup>&</sup>lt;sup>1</sup>For extension of ExtremeWireless deployment via Inter Controller Mobility.

Comp. Source	Comp. Dest	Protocol (TCP/UDP)	Src Port	Dest Port	Service	Remark	Open Firewall Req'd
Appliance	RADIUS Server	UDP	Any	1813	RADIUS Accounting	If enabled RADIUS accounting	Optional
Appliance	RADIUS server	UDP	Any	1814	RADIUS Authentication and Authorization	If using RADIUS AAA	Optional
Appliance	RADIUS server	UDP	Any	1815	RADIUS Accounting	If enabled RADIUS Accounting	Optional
Dynamic Auth. Server (NAC)	Appliance	UDP	Any	3799	DAS	Request from DAS client to disconnect a specific client	Optional
Appliance	AeroScout Server	UDP	1144	12092	Location Based Service Proxy	Aeroscout Location-Based Service	Optional
AeroScout Server	Appliance	UDP	12092	1144	Location Based Service Proxy	Aeroscout Location-Based Service	Optional
Appliance	Extreme Cloud IQ	TCP	Any	443	NSight	Statistics Report into ExtremeCloud IQ	Yes

# **IETF STANDARDS MIB SUPPORT:**

RFC No.	Title	Groups Supported
Draft version of 802.11	IEEE802dot11-MIB	
1213	RFC1213-MIB	Most of the objects supported
1573	IF-MIB	ifTable and interface scalar supported
1907	SNMPv2-MIB	System scalars supported
1493	BRIDGE-MIB	EWC supports relevant subset of the MIB
2674	P-BRIDGE-MIB	EWC supports relevant subset of the MIB
2674	Q-BRIDGE-MIB	EWC supports relevant subset of the MIB

#### **EXTREME NETWORKS PRIVATE ENTERPRISE MIB SUPPORT**

Extreme Networks Private Enterprise MIBs are available in ASN.1 format from the Extreme Networks website at: <a href="https://extremeportal.force.com/">https://extremeportal.force.com/</a>.

#### **Standard MIBs**

Title	Description
IEEE802dot11-MIB	Standard MIB for wireless devices
RFC1213-MIB.my	Standard MIB for system information
IF-MIB	Interface MIB
SNMPv2-MIB	Standard MIB for system information
BRIDGE-MIB	VLAN configuration information that pertains to EWC
P-BRIDGE-MIB	VLAN configuration information that pertains to EWC
Q-BRIDGE-MIB	VLAN configuration information that pertains to EWC

## **Siemens Proprietary MIB**

Title	Description
HIPATH-WIRELESS-HWC-MIB.my	Configuration and statistics related to EWC and associated objects
HIPATH-WIRELESS-PRODUCTS-MIB.my	Defines product classes
HIPATH-WIRELESS-DOT11-EXTNS-MIB.my	Extension to IEEE802dot11-MIB that complements standard MIB
HIPATH-WIRELESS-SMI.my	Root for Chantry/Siemens MIB

## **802.11AC AND 802.11N CLIENTS**

Please refer to the latest release notes for ExtremeWireless™ 10.41.09 or later and/or ExtremeWireless WiNG 5.9.02 or later for the list of compatibility test devices.

## **RADIUS SERVERS AND SUPPLICANTS**

## **RADIUS Servers Used During Testing**

Vendor	Model OS	Version
FreeRADIUS	1.1.6	FreeRADIUS
FreeRADIUS	1.0.1	FreeRADIUS
IAS	5.2.3790.3959	Microsoft Server 2003 IAS

04/05/2022 P/N: 9037458-00 Subject to Change Without Notice Page: 14 of 18

Vendor	Model OS	Version
SBR50	6.1.6	SBR Enterprise edition
NPS	6.0.6002.18005	Microsoft Server 2008 NPS

# 802.1x Supplicants Supported

Vendor	Model OS	Version
Juniper Networks® / Funk	Odyssey client	Version 5.10.14353.0
		Version 5.00.12709.0
		Version 4.60.49335.0
	Wireless Zero Configuration	Version Windows XP-4K- 891859-Beta1
Microsoft®	Wireless Network Connection Configuration	Version Microsoft Window Server 2003, Enterprise Edition R2 SP2
	Wi-Fi Protected Access 2 (WPA2)/Wireless Provisioning Services Information Element (WPS IE) update for Windows XP with Service Pack 2	Version WindowsXP- KB893357-v2-x86-ENU.exe
Intel®	Intel PRO Set/Wireless	Version 13.0.0.x (with Windows® Intel® driver version 13.0.0.x)
Microsoft® Wireless Zero Windows 7, 8, 8.1 Pro, 10 Pro Windows Phone 8.1, Windows Mobile 10 Provided with Windows		Provided with Windows®

# **Appliance LAN Switch Verification**

Vendor	Model OS	Version	Role
Extreme	X-460-G2	12.5.4.5	XIQC connection
Extreme	X440G2-48p-10G4	21.1.1.4	XIQC connectivity
Extreme	Summit 300-48	7.6e1.4	XIQC connection
Extreme		(6.0.1.1_B003) (PRIVATE) HW Base: ERS 4850	XIQC connection
Extreme	K6	08.63.02.0004	XIQC connection
Extreme	K6	08.42.03.0006	XIQC connection

04/05/2022 P/N: 9037458-00

Vendor	Model OS	Version	Role
Extreme	X440G2-48p-10GE4	21.1.5.2	XIQC connection
Extreme	X440-G2-12p	21.1.1.4	XIQC connection
Extreme	X460-48p	12.5.4.5	XIQC connection
Cisco	Catalyst 3550	12.1(19)EA1c	XIQC connection

## **CERTIFICATION AUTHORITY**

Server Vendor	Model OS	Version
Microsoft CA	Windows Server 2003 Enterprise Edition	5.2.3790.1830
Microsoft CA	Windows Server 2008 Enterprise Edition	6.0
OpenSSL	Linux	1.1.1g

## **RADIUS ATTRIBUTES SUPPORT**

## **RADIUS Authentication and Authorization Attributes**

Attribute	RFC Source
Called-Station-Id	RFC 2865, RFC 3580
Calling-Station-Id	RFC 2865, RFC 3580
Class	RFC 2865
EAP-Message	RFC 3579
Event-Timestamp	RFC 2869
Filter-Id	RFC 2865, RFC 3580
Framed-IPv6-Pool	RFC 3162
Framed-MTU	RFC 2865, RFC 3580
Framed-Pool	RFC 2869
Idle-Timeout	RFC 2865, RFC 3580
Message-Authenticator	RFC 3579
NAS-Identifier	RFC 2865, RFC 3580
NAS-IP-Address	RFC 2865, RFC 3580
NAS-IPv6-Address	RFC 3162
NAS-Port	RFC 2865, RFC 3580
NAS-Port-Id	RFC 2865, RFC 3580
NAS-Port-Type	RFC 2865, RFC 3580
Password-Retry	RFC 2869

04/05/2022 P/N: 9037458-00 Subject to Change

Attribute	RFC Source
Service-Type	RFC 2865, RFC 3580
Session-Timeout	RFC 2865
State	RFC 2865
Termination-Action	RFC 2865, RFC 3580
Tunnel Attributes	RFC 2867, RFC 2868, RFC 3580
User-Name	RFC 2865, RFC 3580
Vendor-Specific	RFC 2865

# **RADIUS Accounting Attributes**

Attribute	RFC Source
Acct-Authentic	RFC 2866
Acct-Delay-Time	RFC 2866
Acct-Input-Octets	RFC 2866
Acct-Input-Packets	RFC 2866
Acct-Interim-Interval	RFC 2869
Acct-Output-Octets	RFC 2866
Acct-Output-Packets	RFC 2866
Acct-Session-Id	RFC 2866
Acct-Session-Time	RFC 2866
Acct-Status-Type	RFC 2866
Acct-Terminate-Cause	RFC 2866

#### **GLOBAL SUPPORT:**

By Phone: +1 800-998-2408 (toll-free in U.S. and Canada)

For the toll-free support number in your country:

https://extremeportal.force.com/

By Email: support@extremenetworks.com

By Web: <a href="https://extremeportal.force.com/">https://extremeportal.force.com/</a>

For information regarding the latest software release, recent release note revisions and documentation, or if you require additional assistance, please visit the Extreme Networks Support website.

Extreme Networks and the Extreme Networks logo are trademarks or registered trademarks of Extreme Networks, Inc. in the United States and/or other countries. All other names (including any product names) mentioned in this document are the property of their respective owners and may be trademarks or registered trademarks of their respective companies/owners. Extreme Networks IPS includes software whose copyright is licensed from MySQL AB.

For additional information on Extreme Networks trademarks, please see: <a href="www.extremenetworks.com/company/legal/trademarks/">www.extremenetworks.com/company/legal/trademarks/</a>